PRINTED: 09/27/2013 FORM APPROVED

CENTERS FOR MEDICARE & MEDICAID SERVICES OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION (X3) DATE SURVEY IDENTIFICATION NUMBER: COMPLETED A BUILDING 01 - MAIN BUILDING 01 445473 08/15/2013 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 914 INDUSTRIAL PARK RD JEFFERSON COUNTY NURSING HOME DANDRIDGE, TN 37725 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR USC IDENTIFYING INFORMATION) TAG DATE TAG CROSS-REFERENCED TO THE APPROPRIATE **DEFICIENCY** K 000 FINITIAL COMMENTS K 000 42 CFR 483,70(a) K3 BUILDING: 0104 K6 PLAN APPROVAL: 1975 K7 SURVEY UNDER: 2000 Existing K8 SNF/NF Type of Structure: Building 0104 (Main Building) POC ACCEPTED is one story, 1975, Type II (000), unprotected noncombustible concrete block and steel frame construction. Building 0104 (Main Building) has SEP **27** 2013 seven smoke compartments and a complete automatic (wet & dry) sprinkler system. Building 0104 (Main Building) is a free standing building that is fully separated from the main building. The Main Building is used for administration, physical therapy, and resident housing. Jefferson County Nursing Home is a campus type facility consisting of four total separated building. including the main building with three separate cottages identified as Building 0204 (Hodges Cottage), Building 0304 (Rogers Cottage), and Building 0404 (Franklin Cottage). Each cottage has a capacity for 10 residents. There are a total of two smoke compartments in each of the three cottages for a total of six smoke compartments. There are a total of thirteen smoke compartments for the main building and three cottages. . A Comparative Federal Monitoring Survey was ! conducted on 8/15/2013 following a State Agency Survey on 7/14/2013, in accordance with 42 Code of Federal Regulations, Part 483: Requirements for Long Term Care Facilities. During this

LABORATORY DIRECTOR'S OR PROVIDERS UPPPLER REPRESENTATIVE'S SIGNATURE

Comparative Federal Monitoring Survey, Building

Administrator

(XE) DATE 1/27/13

Any deficiency statement ending with an asterisk (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are discloseble 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

# DEPARTMENT OF HEALTH AND HUMAN SERVICES CENTERS FOR MEDICARE & MEDICARD SERVICES

AND PLAN O	OF DEFICIENCIES F CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:		LE CONSTRUCTION 01 - MAIN BUILDING 01	(X3) DAT	O. 0938-03: E SURVEY IPLETED	
		445473	B. WNG		`   <sub>•</sub>	3/15/2013	
JEFFERS	PROVIDER OR SUPPLIER ON COUNTY NURSING 1		STREET ADDRESS, CITY, STATE, ZIP CODE  914 INDUSTRIAL PARK RD DANDRIDGE, TN 37725				
(X4) ID PREFIX TAG	(EACH DEFICIENC)	atement of deficiencies Y must be preceded by full SC identifying information)	ID PREFIX TAG	PROVIDER'S PLAN OF CO (EACH CORRECTIVE ACTION CROSS-REFERENCED TO THE DEFICIENCY)	N SHOULD BE	(XS) COMPLETION DATE	
K 000	0104 (Main Building) Home was found not requirements for Part Medicaid as set forth Regulations, 483.70 (res)	of Jefferson County Nursing to be in compliance with the dicipation in Medicare and in Title 42, Code of Federal a) et seq. (Life Safety from	K coc				
	RO41: NFPA 101 Life: Required comidor sepi CMS determined the frefutation and evident the time of the survey determination, CMS dand the facility remains compliance with all citic CMS Form-2567, State	eleted KO41 on 9/9/2013 s out of substantial ations noted in this revised ament of Deficiencies.					
K 029 SS=E	Regulations, 483,70 (a Fire). NFPA 101 LIFE SAFE: One hour fire rated cor fire-rated doors) or an a extinguishing system in and/or 19.3.5,4 protect	tie 42, Code of Federal ) et seq. (Life Safety from  FY CODE STANDARD  Instruction (with % hour  Approved automatic fire In accordance with 8,4,1 In the safety from the safety from the safety fire In accordance with 8,4,1 In the safety fire safety from the safety fire In the safety fire safety from the safety fire  In the safety from the safety from the safety fire  In the safety from the safety from the safety fire  In the safety from the	K 029	Boxes with combustible iter stored in the electrical room Unit Four (4) where the gen fer switch is located.	on Nursing	09/29/13	
f	option is used, the area other spaces by smoke foors. Doors are self-c	resisting partitions and losing and non-rated or plates that do not exceed		Boxes with combustible iten stored in other electrical roc generator transfer switches Electrical rooms where trans are located are locked areas (continued on next page)	oms where are located. afer switches		

# DEPARTMENT OF HEALTH AND HUMAN SERVICES CENTERS FOR MEDICARE & MED

STATEMENT	OF DEFICIENCIES	& MEDICAID SERVICES (X1) PROMDER/SUPPLIER/CLIA	(V2) ADH YOU		MB NO, 0938-039 (3) DATE SURVEY			
		AN OF CORRECTION IDENTIFICATION NUMBER:		(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - SIAIN BUILDING 01				
		445473	B. WING	- · ·	08/15/20			
NAME OF P	ROVIDER OR SUPPLIER			STREET ADDRESS, CITY, STATE, ZIP CODE				
JEFFERR	ON COUNTY NURSING	3 House		914 INDUSTRIAL PARK RD	-			
· · · · · · · · · · · · · · · · · · ·	OH OCCUPATION OF THE OCCUPATIO	- TOME		DANDRIDGE, TN 97725				
(X4) ID PREFIX TAG	! (EACH DEFICIE)	STATEMENT OF DEFICIENCIES NCY MUST BE PRECEDED BY FULL R LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORREC (EACH CORRECTIVE ACTION SHO CROSS-REFERENCED TO THE APPR DEFICIENCY)	OLD BE	OUS) COMPLETION DATE		
K 029	Continued From page 2		K 029	(continued from page 2)				
	This STANDARD Is	not met as evidenced by:		access by Maintenance Department staff				
	Based on observat	ion and interview, the facility	-	and the Administrator. The Maintenance				
	emergency generat	quired clearence around the or transfer box for the		Director and Administrator will conduct				
	generator in the electrical room. The deficient practice affected one of thirteen smoke compartments, four staff and twenty realdents. The facility has the capacity for 160 bads with a census of 150 the day of survey.  Findings include:  Observation on 8/15/13 at 2:30 p.m. revealed the generator transfer switch was located in an electrical room in nursing area unit 4. The room contained half a dozen cardboard boxes full of combustible material stored less than one foot away from the generator transfer electrical switches.			periodic inspections to ensure o	ombus-			
				tible materials have not been p	laced in			
				these areas.				
				This finding and the Plan of Cor	rection for			
				such will be reviewed by the fac				
				Quality Assurance/Performance	-			
i				ment Team at the September m				
J				This will remain an open item for	:			
				sion each month until it is deter	• :			
.				that the measures put in place t				
]		•		recurrence are proven effective	- 1			
1	Interview with the M	aintenance Supervisor on			·			
ŀ	avere of the reculre	revealed the facility was not ment that prohibits the use	j		!			
i	the electrical genera	tor transfer room as a	<b> </b>		į			
. !	storage room for cor	mbustible items and of the	Ì		· í			
	requirement to maini	tain 30 inches clearance						
	apriveeri ma álactic	al controls and other items.						
ł	The census of 160 w	as verified by the		•	ļ			
	Administrator on 8/1:	5/13. The finding was	1. }					
	by the Maintenance : Interview on 8/15/13.	Administrator and verified     Supervisor during the exit			į			
	Actual NFPA Standa About Electrical Equi	rd: NFPA 70, 110-26, Spaces			1	٠,		
	provided and maintai	ined about all electric						

A 141 C.	O LOK MEDICAKE &	MEDICAID SERVICES			· · · · · · · · · · · · · · · · · · ·	OMB N	<u>0, 0938-0391                                    </u>
		(X1) PROVIDER/BUPPLIER/GLIA IDENTIFICATION NUMBER:			CONSTRUCTION 1 - MAIN BUILDING 01	(X3) DATE SURVEY COMPLETED	
· 		445473 B. WING 08/1		/16/2013			
NAME OF PROVIDER OR SUPPLIER				81	TREET ADDRESS, CITY, STATE, ZIP CODE		
				81	4 INDUSTRIAL FARK RD		
JEFFERSON COUNTY NURSING HOME			•	1	ANDRIDGE, TN 37725		
S(1) 10	CANADA CA		-	<u> </u>			,
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			D PROVIDER'S PLAN OF COR PREFIX (EACH CORRECTIVE ACTION: TAG CROSS-REFERENCED TO THE A DEFICIENCY)		COMP.	
K 029	Continued From page 3		к	029			]
	equipment to permit r	eady and safe operation	ļ	1			١.
	and maintenance of a	uch equipment. Enclosures		i			<b>!</b>
	housing electrical app	paratus that are controlled by					}
	lock and key shall be	considered accessible to					<b> </b>
	qualified persons.		1	i			i i
!	(a) Working Space. V	Vorking space for equipment			•		}
	operating at 600 voite	, nominal, or less to ground		ł			
	and likely to require e	xamination, adjustment,		ļ			} 1
	servicing, or mainten	ance while energized shall	į	- 1		•	
	comply with the dime	nsions of (1), (2), and (3) or		- 1			<u> </u>
	as required or permit	ed elsewhere in this Code.		- 1	•		Ì
	(1) Depth of Working	Space. The depth of the		- 1			
	working apace in the	direction of access to live than indicated in Table					į l
	110-26(a) Distances	shall be measured from the	1	- 1			j
	live parts if such are	woosed or from the	1				
	enclosure front or one	ening if such are enclosed.					:
	(2) Width of Working	Space. The width of the		ļ	·	, .	
	working space in from	t of the electric equipment		- }			ĺ
	shall be the width of t	ne equipment or 30 in. (762		i			[
,	mm), whichever is gre	eater. In all cases, the work					į
	space shall permit at t	east a 90 degree opening		i			
	of equipment doors or	hinged panels.					
	(3) Height of Working	Space. The work space		1	7. · .		
ĺ	shall be clear and ext	end from the grade, floor, or		Į			
	platform to the height	required by Section		į			, ,
	110-26(e). Within the	height requirements of this	i	ĺ			į .
		ent associated with the		!			
	electrical installation is	ocated above or below the		i			
	electrical equipment 8	hall be permitted to extend		i			, I
	the electrical equipme	53 mm) beyond the front of	1				! <b>!</b>
	in clear Space Mai	nt. rking space required by this	1	j			į
	section shall not be us	rang space requiled by this	1				
ļ	normally enclosed live	note on average. Wildi		-			j
į	inspection or secricing	, the working space, if in a	{	-		i	
į	Dagagade or opposit	al open space, shall be					; <u> </u>
1	suitably guarded.	a skali ekase silali ha	1				į
İ	and Grandon			ł			
		· · · · · · · · · · · · · · · · · · ·	t .				

CENTERS FOR MEDICARE & MEDICAID SERVICES FORM APPROVED OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION AND PLAN OF CORRECTION X3) DATE BURVEY IDENTIFICATION NUMBER: A. BUILDING 01 - MAIN BUILDING 01 COMPLETED 445473 B. WING 08/15/2013 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE JEFFERSON COUNTY NURSING HOME 914 INDUSTRIAL PARK RD DANDRIDGE, TN 37726 SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LEC IDENTIFYING INFORMATION) (X4) ID PREFIX PROVIDER'S PLAN OF CORRECTION PREFIX EACH CORRECTIVE ACTION SHOULD BE TAG CROSS-REFERENCED TO THE APPROPRIATE TAG DEFICIENCY K 029 ! Continued From page 4 K 029 Actual NFPA standard: NFPA 110, 5-11.1, The room in which the EPS equipment is located shall not be used for storage purposes. NFPA 101 LIFE SAFETY CODE STANDARD K 066 K 086 | Metal containers with self-closing covers 09/29/13 SS=D Smoking regulations are adopted and include no into which ashtrays may be emptied so as less than the following provisions: to ensure smoking material is completely extinguished prior to disposal with other (1) Smoking is prohibited in any room, ward, or compartment where flammable liquids, combustible trash will be provided at the combustible gases, or oxygen is used or stored smoking areas near Nursing Units Three and in any other hazardous location, and such area is posted with signs that read NO SMOKING (3) and Four (4). or with the international symbol for no smoking.

(2) Smoking by patients classified as not responsible is prohibited, except when under direct supervision.

- (3) Ashtrays of noncombustible material and safe design are provided in all areas where smoking is permitted.
- (4) Metal containers with self-closing cover devices into which ashtrays can be emptied are readily available to all areas where smoking is permitted. 19.7.4

This STANDARD is not met as evidenced by:
Based on observation and interview, the facility
failed to provide metal containers with self-closing
devices into which ashtrays can be emptied. The
deficient practice affected two of thirteen smoke
compartments, four staff and two residents. The

Such metal containers referenced above will be provided at other areas of the campus where smoking is permitted.

The Housekeeping and Laundry Supervisor will conduct visual inspections of designated smoking areas at least monthly to ensure containers are in place and used properly by Housekeeping staff.

This finding and the Plan of Correction for such will be reviewed by the facility's Quality Assurance/Performance Improvement Team a the September meeting. This will remain an open item for discussion each month until it is determined that the measures put in place to prevent recurrence are proven effective.

PRINTED: 09/27/2013

PRINTED: 09/27/2013 FORM APPROVED

CENTER	S FOR MEDICARE &	MEDICAID SERVICES			OMB NO. 0938-0	<u> 391</u>
STAYEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/BUPPLIER/CLIA IDENTIFICATION NUMBER:	1 ' '	E CONSTRUCTION 01 - MAIN ENILDING 01	(X3) DATE SURVEY COMPLETED	
	445473		8. WING		08/15/2013	
NAME OF P	ROVIDER OR SUPPLIER		<u>l</u>	STREET ADDRESS, CITY, STATE, ZIP CODE	00/10/2013	
JEFFERSON COUNTY NURSING HOME				914 INDUSTRIAL PARK RD DANDRIDGE, TN 37725	••	
(X4) JD PREFIX TAG	(EACH DEFICIENC	ATEMENT OF DEFICIENCIES Y MUST BE PRECEDED BY FULL LSC IDENTIFYING INFORMATION	ID PREFIX YAG	PROVIDER'S PLAN OF CORRECT (EACH CORRECTIVE ACTION SHOU CROSS-REFERENCED TO THE APPRO DEFICIENCY)	LO BE COMPLETE	
K 068	facility has the capaci census of 150 the da Findings Include:  Observation on 8/15/ p.m. in the main build outdoor resident amo and Unit 4 dining root with metal containers which ashtrays could smoking materials to prior to disposal with Interview on 8/15/13 a Maintenance Supervi- not aware of the requi-	ily for 160 beds with a y of survey.  13 from 11:57 a.m. to 1:00 iling revealed two designated king areas near the Unit 3 ms both were not equipped with self-closing cover into be emptied and to permit be completely extinguished other combinatible trash.  at 1:00 p.m., with the facility was irement to provide a metal	K 066			
K 147 SS≂E	by the Maintenance S interview on 8/15/13.  Actual NFPA Standard Ashtrays of noncombudesign are provided in permitted. Metal conticover devices into while are readily available to permitted.  NFPA 101 LIFE SAFE  Electrical wiring and e	as verified by the //3. The finding was Administrator and verified upprvisor during the exit  i: NFPA 101 19.7.4 (3), (4), ustible material and safe all areas where smoking is alners with self-closing ich ashtrays can be emptied all areas where smoking is TY CODE STANDARD quipment is in accordance at Electrical Code, 9.1.2	K 147	mattress pumps and oxygen conc will be plugged directly into a	I ' -	L3·
	·			(continued on next page)		

4.9

GENTERS FOR MEDICARE & ME STATEMENT OF DEFICIENCIES (X1		(X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIF		E CONSTRUCTION .		<u>MB NO. 0938-039</u> 3) Date Survey	
AND PLAN OF CORRECTION		IDENTIFICATION NUMBER:	A. BUILDING	COMPLE			
<del>-</del>	446473		B. WING	08/15	08/15/2013		
NAME OF P	SE OF PROVIDER OR SUPPLIER		· 1	STREET ADDRESS, CITY, STATE, ZIP CODE		, ,	
JEFFERS	ON COUNTY NURSING	HOME .	•	914 INDUSTRIAL PARK RD DANDRIDGE, TN 37725			
(X4) ID PREFIX TAG	i (Each Deficien	STATEMENT OF DEFICIENCIES ICY MUST BE PRECEDED BY FULL R LSC IDENTIFYING INFORMATION)	PREFIX TAG	PROVIDER'S PLAN OF CORRECT (EACH CORRECTIVE ACTION SHOU CROSS-REFERENCED TO THE APPRO DEFICIENCY)	LD BE	(X5) COMPLETIO DATE	
K 147	Continued From page 6		K 147	(continued from page 6)			
			-	wall outlet in resident Room 109.	. Power		
	This STANDARD is	not met as evidenced by:		strips will not be used for non-me	edical		
	Based on observati	on and Interview, the facility		items and per stated guidelines in	n Room		
	substitute for fixed v	use of extension cords as a viring to provide power to		109.			
	medical equipment or other appliances in permanent use. The deficient practice affected			All medical equipment including	air		
	one of thirteen smol	(e compartments, staff and		mattress pumps and oxygen cond	,		
:	twenty residents. Ti	he facility has the ceoacity for		will be plugged directly into wall			
	TOU DOOS WITH 8 COT	sus of 160 the day of survey.		resident rooms. Power strips wil			
1	Findings include:			used for non-medical items and p	• 1		
į	Observation on 8/15	i/13 at 12:15 p.m. in the main	•	guidelines in resident rooms.	let stated		
i	building revealed an	air mattress pump and		Roldenies at residelit (COIIIS	j		
	oxygen concentrator	connected to a six plug sident Room 109. The	-	To ensure this is accomplished, st	aff educa-		
Ì	medical equipment	was not plugged directly into a		tion outlining proper use of plugs	for medi-		
	wall outlet.	The state of the s	] .	cal equipment and proper use of	power		
į	Interview with the Ma	aintenance Sypervisor on		strips will take place for Nursing a	and		
į	8/18/13 at 12:15 p.m	i. revealed the facility was not		Housekeeping and Laundry perso	nnel.		
- 1	aware of the requires	ment that prohibits the use of	İ	Certified Nursing Assistant will be	asked to		
	for permanent use in	ters for medical equipment		perform a plug assessment a the	beginning		
j	.'		1	of each shift as they perform othe	er routine		
	The census of 150 w Administrator on 8/18	es verified by the 5/13. The finding was		checks on residents.	İ		
Į.	acknowledged by the	Administrator and verified		This finding and the Plan of Corre	ction for		
ļ	by the Maintenance : interview on 8/15/13.	Supervisor during the exit		such will be reviewed by the facili			
ĺ				ity Assurance/Performance Impro	· 1		
	Actual NFPA Standar	rd: NFPA 70, Article 400-8.		Team at the September meeting.	l l		
. ]	umess specifically pe flexible cords and col	ermitted in Section 400-7, bles shall not be used as a		-			
i	substitute for the fixe	d wiring of a structure.		remain an open item for discussion	n eacn		
[	CMS Manual System	, Pub. 100-07 State		(continued on next page)			
	uperations, Provider	Certification; August 17,	1				

		MEDICAID SERVICES				OMB N	O. 0938-0391
STATEMENT OF DEPICIENCIES (X1) PROVIDER/SUPPLIER/CLIA AND PLAN OF CORRECTION (DENTIFICATION NUMBER:		F		CONSTRUCTION 1 - MAIN BUILDING 01	(X3) DATE SURVEY COMPLETED		
· · · · · · · · · · · · · · · · · · ·	445473		B. WING			08/15/2013	
NAME OF PROVIDER OR SUPPLIER				8	TREET ADDRESS, CITY, STATE, ZIP CODE		
JEFFERS	ON COUNTY NURSING H	OME .	ĺ	•	14 INDUSTRIAL PARK RD		
	,			ם	ANDRIDGE, TN 37725		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFI TAG	PREFIX (EACH CORRECTIVE ACTION SHOULD BE			COMPLETION DATE
<b>K</b> 147	Continued From page 7 2007. Power strips may not be used as a substitute for adequate electrical outlets in a		<b>K</b> 1	147	(continued from page 7) month until it is determined that the	<u>.</u>	
	facility. Power strips n monitor, and printer. F	nay be used for a computer.		Ì	measures put in place to prevent recur-		
l	designed to be used u	with medical devices in			rence are proven effective.		
	patient care areas. Pr strips are used includ- fault and over-current preventing cords from and using power strip number and types of c any circuit can potenti- fire. The use of ground	ecautions needed if power et installing internal ground protection devices; becoming tripping hazards; s that are adequate for the devices used. Overload on isly cause overheating and d fault circuit interruption red in locations near water			Toron are proven enecuves.		
- ]				ĺ			
,			1				
-				1	. •		